

Consequential train accident details for the year 2017 -18

Sl. No	Date/ ID	Class ification	Divn	Section	Block Section/ Station	Brief Particulars	Level of enquiry & Final Cause	Casualty		Staff Responsible
								Killed	Injured	
1	17.05.17 at 06:00 Hrs, ID 20170515001	D3	MYS	CTA-BAHI	CTA-BAHI	Train No.56909 Pass., while passing over Bridge No.45, 1 st coach (GSLR SWR 93714) front truck from TE was derailed at KM 36/200 - 300 between Chitradurga (CTA) - Balenahalli (BAHI) Stations	SAG Officers Enquiry Committee Disturbance to the track alignment due to hitting of the Girder No.01 of Bridge No.45 by unknown Road Vehicle.	Nil	Nil	<p>Primary : No Railway Staff.</p> <p>Secondary : 1. Vinay.K, SSE/P.Way/CTA 2. Sevy Naik, JE/P.Way/CHKE</p> <p>Blameworthy : M. Narayana Murthy, ADEN/CTA.</p>

Consequential train accident details for the year 2018 -19

Sl. No.	Date/ ID	Classification	Divn	Section	Block Section / Station	Brief Particulars	Level of enquiry & Final Cause	Casualty		Staff Responsible
								Killed	Injured	
1.	20.07.2018 at 17.18 hrs. ID-20180715004	D3	SBC	CSDR-BYPL	BYPL-CSDR	Loco No. 40165/PA of Tr. No. 12628 (NDLS-SBC Karnataka Exp), front pair of wheels detailed at KM No. 01/700-800 between CSDR-BYPL (Main Line).	JAG Officers' level/ Non fitment of check rail opposite to the nose of crossing at Point 4B at Km 1/700-800 affected guidance of Locomotive wheel from the throat to the nose of the crossing, causing the leading outer wheel of the Locomotive to climb over the rail at the nose of the 1 in 8 ½ RH crossing.	Nil	Nil	Primary: 1. Sri. G. Sunil Kumar, JE/P.Way / YNK 2. Sri. G. Veerabha draiah, SSE/P. Way/YNK Blameworthy: Sri. Sridhara M. G., JE/P.Way/ CSDR

Consequential train accident details for the year 2019 -20

Sl. No	Date/ ID	Class cificat ion	Divn.	Section	Block Section/ Station	Brief Particulars	Level of enquiry & Final Cause	Casualty		Staff Responsible
								Killed	Injure d	
1.	10.11.19 at 09.40/ ID: 2019111 5002	D3	SBC	SBC- SA	RYC- MZU	Derailement of front pair of Wheels of Loco No. 40440/WDP4D /GOC of Tr. No. 56514 (SBC-KIK Fast Passenger) at KMs 113/200 bet. RYC-MZU stations of SBC-SA section of Bengaluru Divn.	Dy.CSO's Level Enquiry (JAG level) & Final Cause: Obstruction (ballast) placed on outer rail table by miscreants.	Nil	Nil	Primary: 1. Obstruction (ballast) placed on outer rail table by miscreants. Blameworthy: 1. Shri Sashikant Singh, LP/G/ SBC.
2.	26.12.19 at 10.55 hrs. ID: 2019121 5001	D3	SBC	MYA -SBC	NYH- SBC	Derailement of leading pair of wheels of the Train Engine of Tr. No. 16023 derailed at KM 01/900-800 in Nayandahalli (NYH) - Bengaluru (SBC) Section of Bengaluru Divn., while attempting to clear the train formation at walking speed with re-railed Loco, 7 th coach, front pair of wheels derailed at same spot.	Dy.CSO's Level Enquiry (JAG level) & Prima Facie Cause: Movement of Tr. No. 16023 over improperly ramped out track which was lifted excessively at the location and in excess of permitted for the route 'D' i.e. 140mm.	Nil	Nil	Primary: 1. Sri. K. Mohan Kumar (Re-engaged), SSE/P.Way/ BID 2. Sri. Narayana Naik (In-charge), SSE/P.Way/KGI 3. Railway Contractor Secondary: 1.Sri. P. Mohan Kumar, Trolley Man/ SSE/P.Way/ KGI 2.Sri. Sampath, Gangmate, SSE/P.Way/KGI Blameworthy: Sri. P. Venkataramana Reddy, ADEN/MYA.

Consequential train accident details for the Year 2020 -21

Sl. No	Date/ ID	Classification	Divn	Section	Block Section / Station	Brief Particulars	Level of enquiry & Final Cause	Casualty		Staff Responsible	Cost of Damage (In Rs.)
								Killed	Injured		
1.	31.12.20 at 20.25 hrs.	D3	MYS	RRB-TLGP	KMSI -ANF	Derailment of leading one pair of Wheel of Loco No.WDP 4D 40522(UBL) of Tr. No. 06529/ SBC-TLGP DN Exp. at KMs 99/400-500.	<p>JA Grade Inquiry & Final Cause: excess unloaded ballast remained on the both side of rails, got entangled by the cattle guard of the locomotive (405221WDP4D,UBL) dragging it into the gap between check rail and running rail and obstructed the wheel movement. As a result on RH side check rail broken into many pieces for a length of- 70 meters and on LH side ER clips broken on alternate sleepers to the extent of 100 numbers. POM/POD at KM 99/314.50. 2. The Cattle Guard of WDP4D Locomotive is wider than WDG4 by more than 250 mm overall. The Empty BT Spl run with WDG4 Loco with lesser clearance of cattle guard escaped the excess ballast left over on track at the derailment location. However some ballast might have been dragged into the check rail gap by the Locomotive of Empty BT Spl. but managed to evade derailment as the quantity might have been less.</p>	Nil	Nil	<p>Primary: 1. Biresh Kumar, SSE/P.Way/SRF</p> <p>Secondary: 2. P K Bharathi, SSE/P.Way/SRF</p> <p>Blameworthy: 1. Tarakeshshwar R. Badade, ADEN/SMET 2. V. Zakir Hussain, SSE/Pway/ASK 3. Manjunath Naik TMNTR-III 4. Umesh Patgar, TMNTR-III 5. Naveen R Naik , TMNTR-IV 6. Chandra Lra Bhovi, TMNTR-IV 7. Ganesh Shekhar Naik , TMNTR-III 8. Raghavendra Gouda, TMNTR-IV 9. Santosh Naik , TMNTR-IV 10. Laxman Shet , TMNTR-IV</p>	Rs. 2,39,876/-

Consequential Train Accident Cases (Railway Board) for the Year 2021 -22

Sl. No	Date/ ID	Classification	Divn	Section	Block Section / Station	Brief Particulars	Level of enquiry & Final Cause	Casualty		Staff Responsible	Cost of Damage (In Rs.)
								Killed	Injured		
1.	23.07.21 at 6.10 hrs. 20210715001	D3	U B L	LD-VSG	DDS-LIM	Diverted Train No. 01134 MAJN - CSTM SF Spl. derailed at KM 39/800 between DDS-LIM (Dudhsagar-Sonalium) of Londa - Vasco section. Leading Loco No. 13594 / PA (02 pairs of wheels front truck) trailing Loco No. 13641 was intact + CR SLR 134034 (All Wheels)+ CR GS 09409 (Front Trolley).	SA Grade Inquiry & Final Cause: Sudden Landslide at the location	Nil	Nil	No staff held responsible.	Rs. 4,43,261/-

IS. No	Date/ ID	Classification	Divn.	Section	Block Section / Station	Brief Particulars	Level of enquiry & Final Cause	Casualty		Staff Responsible	Cost of Damage (In Rs.)
								Killed	Injured		
2.	12.11.2021 at 03.58 hrs 20211115001	D3	SB C	BYPL-SA	SZV-TPP	Derailment of Train No 07390 Cannannur-Yeswantpur Exp due to boulder fallen due to landslide and hit the train between TPP-SZV on 12.11.2021 at 03.58 hrs	SA Grade Inquiry & Final Cause: After careful consideration of the factual, Material and circumstantial evidence available with us till now, the Inquiry committee has come to conclusion that " the derailment of 07390 (CAN - YPR Special) between Toppur (TPP) - Sivadi (SZV) stations at Km.47/800-900 on Omalur (OML) - Baiyyappanahalli (BYPL) single line section of Bengaluru Division of South Western Railway on dated.12.11.2021 was due to boulder hitting the train after train engine and 4 coaches passed.	Nil	Nil	Primary: Nil Secondary: Sri.R.V.kuppurai, SSE/P.way/KPN Blameworthy: 1. Sri.A.Govindaraj, SSE/PWay/DPJ/South (Subsection.) 2. SriK.Pannerselvam, Manager/E1/Expert /RVNL/SBC	61,65,448/-

3.	18.01.2 022 08.55 hrs	D3	UB L	CRZ- DDS	CRZ - DDS	Train No.18048 Amaravati Exp. while passing at KM. 36/8-9 in block section of DDS- CRZ one set of leading wheel of leading loco got derailed.	The derailment of the train was due to use of defective closure piece at the fish plate joint.	Nil	Nil		
----	--------------------------------	----	---------	-------------	-----------------	---	---	-----	-----	--	--

Consequential Train Accident Cases (Railway Board) for the Year 2023-24

Sl. No	Date/ ID	Classification	Divn.	Section	Block Section/ Station	Brief Particulars	Level of enquiry & Final Cause	Casualty		Staff Responsible	Cost of Damage (In Rs.)
								Killed	Injured		
1.	21/04./23 02.12 hrs	D4	SBC	RYC-MZU	RYC-MZU	6 wagon of HVRN derailed between RYC-MZU section of SBC division.	Level of enquiry: JAG Grade Final Cause: The use of non-standard joggled fish plate instead of combination joggled fish plate joint with non- standard fasteners and washers at 52kg/ 60Kg combination weld, resulted in misalignment of the fishplate when a loaded rake passed over it. The vertical height between the rail table and the top of the displaced joggled fish plate became less than the flange height when the 3rd wagon passed over the joint, coupled with coinciding dynamic forces of CBC movement while notching up in curvature resulting in the mounting of the outer wheel of the wagon over the rail table, ultimately leading to the derailment.	Nil	Nil	Primary: 1. Senthil Kumar, SSE/P.Way/ DPJ (N). 2. V. Krishna /GateMan. 3. Gunjan kumar TMR/KJM Secondary: 1. Vaithilingam JE/ P.way/DPJ. 2. Chandaka Hari Babu, ALP/KJM Blameworthy: 1. Justin K./ Track man IV. 2. Aashish raj/Track Man IV 3. Mukesh kumar sharma/ LP (G)/ KJM. 4. V.E.E Kavinilavu, SM/RYC.	Rs. 1,06,31,546.00

2	15/05/23 11.25 hrs	D3	SB C	KSM- BSM	KSM- BSM	At 11.27 hours, TMR of Train No.22625 informed that while passing BSM station at 11.25 hrs., one pair of wheel of second coach from rear-SRCZ 126687 derailed at KM 267/15 after passing LSS of BSM station. Station limit.	Level of enquiry: SAG Grade Final cause: The improper functioning of SSD at the passage of train No.22625, which was not able to maintain the proper clearance at JOH(Junction of Head) led to the mounting of wheel flange towards the cross-over rather than the main line which was finally pulled by the front portion of the train in dynamic state towards the Main Line because of the tight coupling of the CBC, thereby derailing the coach.	Nil	Nil	Primary: 1. Elvis Patrick, SSE/PW/BWT 2. Chandra Sekhar rao, SSE/S/KPN Secondary: 1. Durgesh Kumar Dhakar, SM/BSM. 2. Anand Kumar Meena, TI/BWT. 3. J. Ranjan, JE/Sig. 4. C.K. Ramanaiah, JE/PW/BWT Blameworthy: 1. Vikram Gahanoliya, ADEN/BWT 2. Ms.P. Susmitha ADSTE/SBC 3. G.Yellappa, Points, Pointsman/B/BSM
---	-----------------------	----	---------	-------------	-------------	---	--	-----	-----	--

3	17/10/23 12:00	D3	UB L	GIN- MRB	GIN- MRB	<p>On 17.10.2023 at 12.00Hrs at Karatagi Yard, the leading trolley of Loco No. 40066/WDP4/KJM got derailed at Point No.102 in Karatagi yard with empty rake formation of Train No.16545 Km No.64/500-600.</p>	<p>Level of enquiry: JAG</p> <p>Final Cause: The train re-started from 50 meters before the top most point with the speed below 15 kmph and passed Point No.100 without any hinderance. While Loco was moving on Hand Operated Point No.102, the cotter and Cotter pin came out due to vibration of Loco movement, resulted in split of Point No.102 and led derailment of leading truck due to two-way movement at Point.</p>	Nil	Nil	<p>Primary: 1. Parashuram M Haranal/ Pointsman "B"/ GGVT</p> <p>Blameworthy: 1. Aravind Kumar TI/ GDG</p>
---	-------------------	----	---------	-------------	-------------	---	--	-----	-----	---